

2004 - 2009 Cadillac XLR: Service Bulletin: Red LED and B2455 After Performing Canada Upgrade Bulletin 15-08-44-001

#PIC6140B: Red LED and B2455 After Performing Canada Upgrade Bulletin 15-08-44-001 - (Dec 21, 2015)

Subject: Red LED and B2455 After Performing Canada Upgrade Bulletin 15-08-44-001

Models: 2005-2009 Buick Allure
2004 Buick Century
2005-2009 Buick LaCrosse
2000-2005 Buick LeSabre
2004-2007 Buick Rainier
2004 Buick Regal
2003-2007 Buick Rendezvous
2005-2007 Buick Terraza
2003-2007 Cadillac CTS
2002-2005 Cadillac Deville
2003-2006 Cadillac Escalade
2002-2004 Cadillac Seville
2004-2006 Cadillac SRX
2004-2011 Cadillac STS
2004 - 2009 Cadillac XLR
2003-2006 Chevrolet Avalanche
2005-2010 Chevrolet Cobalt
2004-2012 Chevrolet Colorado
2005-2013 Chevrolet Corvette
2005-2006 Chevrolet Equinox

2004-2005 Chevrolet Express
2006-2011 Chevrolet HHR
2001-2005 Chevrolet Impala
2004-2012 Chevrolet Malibu
2002-2005 Chevrolet Monte Carlo
2003-2007 Chevrolet Silverado
2003-2006 Chevrolet Suburban
2003-2006 Chevrolet Tahoe
2009-2009 Chevrolet Trailblazer
2005-2009 Chevrolet Uplander
2003-2005 Chevrolet Venture
2004-2012 GMC Canyon
2002-2009 GMC Envoy
2003-2005 GMC Savana
2003-2007 GMC Sierra
2003-2006 GMC Yukon/Yukon XL
2003-2007 Hummer H2
2006-2011 Hummer H3
2001-2003 Oldsmobile Aurora
2002-2004 Oldsmobile Bravado
2003-2004 Oldsmobile Silhouette
2003-2005 Pontiac Aztec
2000-2005 Pontiac Bonneville
2007-2010 Pontiac G5
2005-2010 Pontiac G6
2004-2008 Pontiac Grand Prix
2003-2009 Pontiac Montana
2005-2006 Pontiac Pursuit
2006-2010 Pontiac Solstice
2004-2005 Pontiac Sunfire
2006 Pontiac Torrent
2005-2008 Pontiac Vibe
2008-2009 Saturn Astra
2007-2010 Saturn Aura

2004-2007 Saturn ION
2003-2004 Saturn L-Series
2005-2007 Saturn Relay
2007-2010 Saturn Sky
2003-2007 Saturn Vue


This PI has been updated to include an updated Warranty Information. Please disregard PIC6140A.


Condition/Concern

A dealer or customer may notice a red LED and DTC B2455 setting current in the VCIM after performing Canada upgrade bulletin 15-08-44-001.

When placing calls or connecting to OnStar, the person on the other end is able to hear the caller clearly.

Recommendation/Instructions

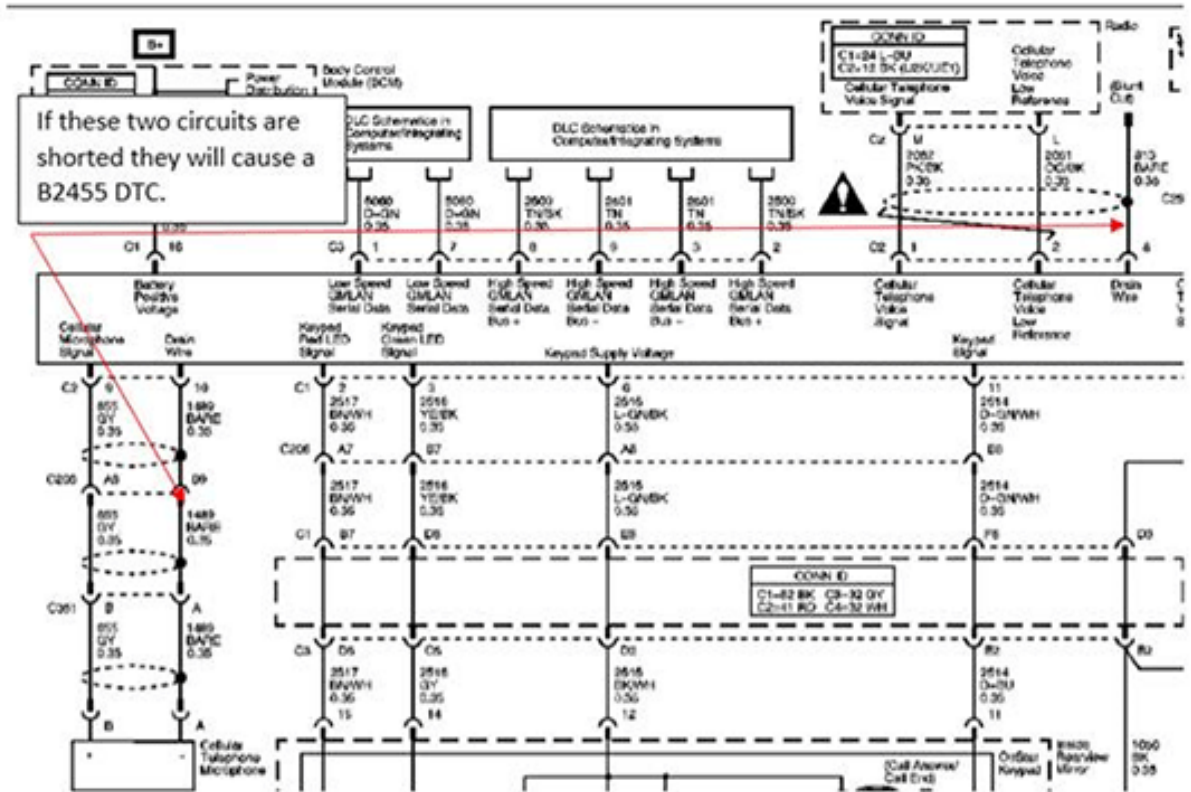

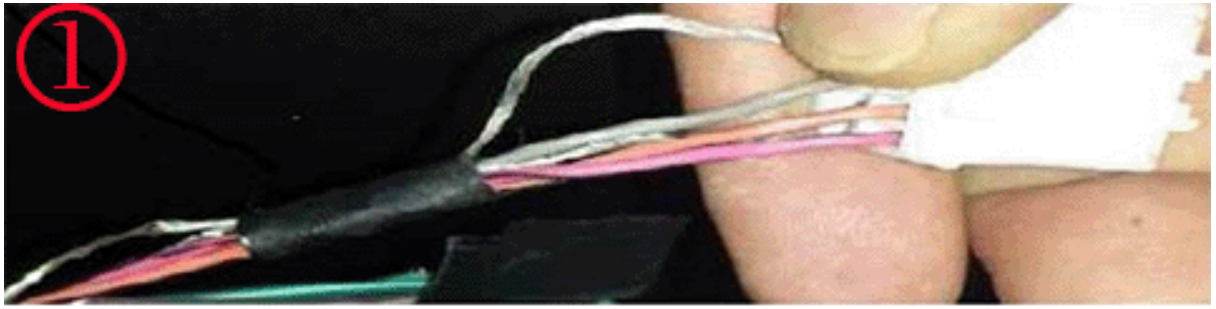

1. It has been found that a short between the audio drain wire and microphone drain wire will cause this concern.
2. Pull back the tape at X2 of the VCIM far enough to see where the bare wires are covered.
3. Tape the bare wires individually to prevent them from shorting. Then tape the harness back up.

Online URL:

<https://www.xlr-net.com/knowledgebase/article/2004-2009-cadillac-xlr-service-bulletin-red-led-and-b2455-after-performing-canada-upgrade-bulletin-15-08-44-001-7.html>